

Preventing Corrosion-related Failures in Electronic Assembly: A Multi-case Study Analysis

E. Weiss

Abstract— Corrosion is a prevalent failure mode in electronic products. The initiation of failure often stems from pre-existing corrosion contamination on soldering leads prior to assembly. This corrosion is further accelerated by environmental factors such as humidity, temperature, and acidity, ultimately leading to degradation of the board and failure during both post-assembly testing and the product's lifespan.

This study presents a method for the real-time, early detection of corrosion contamination on electronic components during the mounting process using pick-and-place technology. The method utilizes the correlation between light reflectance from soldering leads during placement photography and the degree of corrosion present. Corroded leads possess a rougher surface and pitting spots which result in different light reflectance compared to pristine leads. This difference can be detected through AI forensic analysis of component images. The study presents an AI model that correlates lead finish with corrosion content and progression, and evaluates its performance on large-scale data.

This study also presents a real-world case where corroded components were identified during the pick-and-place process, but later failed during in-circuit testing (ICT). The post-failure analysis, using scanning electron microscopy/energy-dispersive spectroscopy (SEM/EDS) and cross-section analysis, confirms the accuracy of the AI failure predictions on multiple components with corrosion, during large-scale production.

The proposed method has been implemented in multiple production lines, where it inspects all components without compromising throughput, and identifies contaminated components that are unsafe. The method has been tested on over 3.5 billion components, and has achieved an accuracy rate of over 99.5% in its predictions.

Index Terms— Artificial intelligence, Corrosion, Deep learning, Electronic assembly, Failure analysis, Intermetallic reactions, Non-destructive testing, Solderability, Surface reflectance, Thermal cycling.

I. INTRODUCTION

Electronic components are the most expensive part of the Bill of Materials (BOM) and are also the most common cause of failures in electronic products. Nevertheless, traditional production methods don't carry out systematic inspection, and seldom any tests are being made at all [1]. This is even though electronic components are the means of most of the failures in electronic products [2]. Unsafe components are more common today because of the electronic components shortage that has made the supply chain more complex and vulnerable to fraudulent falsifications [3]. As a result, components that were obtained from non-reliable sources, recycled components, components that were

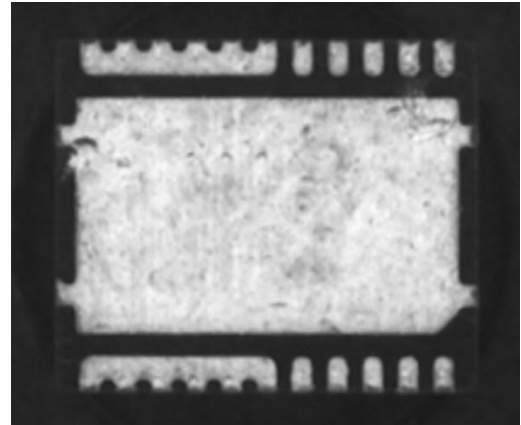


Fig. 1. VSON-12 Gate Drivers NexFET images captured by an ASM Siplace SX mounting machine and detected by Cybord.ai system with quality issues.

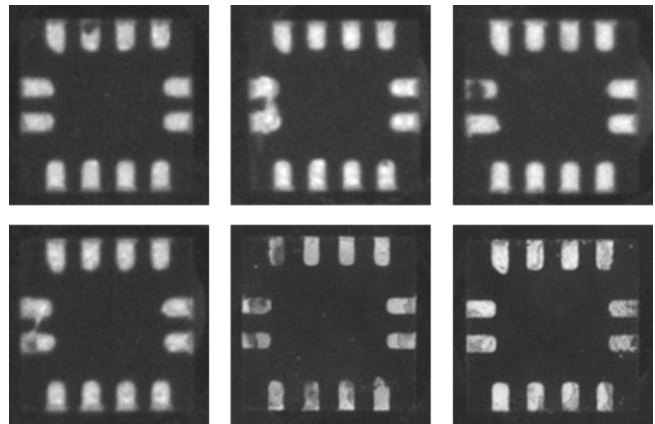


Fig. 2. QFN-12 Power switch images captured by an ASM Siplace SX mounting machine and detected by Cybord.ai system with quality issues: Terminal contamination, Corrosion, Shorts.

poorly stored, handled, or old components are more frequently used by the electronic industry. These components have a higher ratio of quality issues. The most dominant cause of the failure of aged components is corrosion propagation.

The electronics industry recognizes corrosion on soldering leads as a potential risk to component solderability [4]. Various traditional methods are used to evaluate the solderability of electronic components [5]. In the defense industry, samples from batches of components suspected of poor solderability must be inspected in accordance with MIL-STD-202, Method 208 [6] and SAE 26262 used in the automotive industry. These methods typically involve testing a

> REPLACE THIS LINE WITH YOUR MANUSCRIPT ID NUMBER (DOUBLE-CLICK HERE TO EDIT) <

small sample of components under specified conditions to assess the ability of the component leads to wet solder and the strength of the bond. However, this approach is based on the assumption that a small sample represents the entire batch, which is not always the case as demonstrated in [7]. Despite this, the impact of corrosion on soldering leads on product quality is often overlooked, despite the numerous studies and evidence on the effect of corrosion on bond strength and reliability [8]-[11].

In this study, we propose a method for detecting defective soldering leads on components during assembly [2], [12], [13]. The method allows for early detection of components with corrosion and contamination in the soldering leads during production, enabling their avoidance. Furthermore, we present evidence of the method's effectiveness by showing how failures caused by corrosion on components during assembly are correlated to field failure analysis cases.

The inspection was carried out using data processed by Cybord.ai electronic component authentication and qualification software [14]. The software interfaces with the pick-and-place (PNP) machines during production and collects images of the components [15]. These images are then processed using a deep learning algorithm that searches for visual defects in the components and flags any suspected components [12], [16]. Additionally, another network is utilized to evaluate the texture of the soldering leads and estimate their solderability [13].

The method was applied to real assembled components. We present examples of electronic components VSON-12 Gate Drivers NexFET in 12-VSON-CLIP package (see Fig. 1), and QFN-12 Power switch (see Fig. 2) with corrosion that was detected by the presented method. The failure analysis of these components was performed using X-ray analysis, scanning electron microscopy (SEM) and energy-dispersive spectroscopy (EDS) microscopy, and visible light microscopy. The analysis demonstrates a clear correlation between the AI-detected corrosion and the corrosion and failure mode identified in the failure analysis. The AI method was then calibrated to detect potential failures that may result in future failures.

II. CORROSION'S IMPACT ON ELECTRONIC PRODUCT RELIABILITY

Corrosion is the most prevalent failure mode in electronic products. Studies on the reliability of electronics impacted by corrosion demonstrate that various factors, such as materials used in the print circuit board assembly (PCBA), dc or ac bias applied, contamination of the PCBA surface by ions, high humidity, dust residues, pollutants comprising ions, etc. can cause significant reliability issues due to corrosion [8]-[11]. Some electronic system failures are caused by corrosion resulting from the formation of a water layer on the surface of the PCBA in areas with high humidity and temperature variations [17], [18]. These failure modes begin with untainted soldering procedures that later take place under conditions favorable to corrosion development. Corrosion that is already

present in the soldering leads before the soldering process has a far more devastating effect as it becomes a breeding ground for the corrosion epidemic.

Contaminations on the surface of the PCBA, residues left from the manufacturing process, as well as corrosion previously present on the soldering leads before assembly, all have an impact on the reliability of the device. Electrochemical migration (ECM) is also a contributing factor to device malfunction [8], [19]. A key factor in this is the flux agents used in the soldering process and the residue, which contains ionic activators that are hygroscopic. These hygroscopic residues on the PCBA decrease the relative humidity, leading to moisture adsorption at lower relative humidity levels [20], [21]. These residues absorb moisture from the atmosphere until they deliquesce and dissolve in the condensed water film, producing an electrolyte solution with a higher conductivity level [22]. This can lead to reduced surface insulation resistance, increased leak current, and ultimately corrosion contamination such as ECM [23], [24].

The issues outlined above do not usually impact solderability as during the reflow process, there is only a small amount of corrosion present, thus the effect on bond strength during production is minimal. However, these phenomena greatly impact the reliability of the product during its lifespan and may also affect the results of post-assembly inspection as the corrosion continues to spread.

III. A PARALLEL FILTER-BASED NETWORK ARCHITECTURE FOR CORROSION DETECTION IN ELECTRONIC COMPONENTS DURING ASSEMBLY

The algorithm interfaces with pick-and-place (PNP) machines during production and collects images of all the components [14]. These images are then processed using a deep learning algorithm that authenticates the components, searches for visual defects, and flags any suspected components [12], [16]. Additionally, another network is utilized to assess the texture of the soldering leads, and estimate the presence of corrosion and the leads' solderability [13]. Detecting corrosion in electronic components is an image classification problem, where images are classified as normal or defective (in some cases, the defective ones can be further classified into finer levels like minor, moderate, or major)

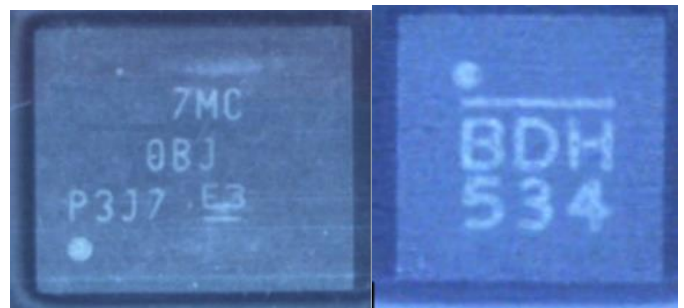


Fig. 3. VSON-12 (left), and QFN-12 (right) images were taken from the top side by an authentication system (an image of similar components from a different production batch).

> REPLACE THIS LINE WITH YOUR MANUSCRIPT ID NUMBER (DOUBLE-CLICK HERE TO EDIT) <

[25].

In this work, we propose a new network architecture specifically designed to address the issue of corrosion contamination [7]. Unlike the serial architecture commonly used in popular image classification models, which employs multiple layers of small filters (often of size 3x3) that are connected in series, our approach utilizes a set of filters with different window sizes that are concatenated in parallel. Each filter is designed to detect a specific type of defective region in the component images and generates a feature that indicates the likelihood that the image contains such defects. The overall feature is the concatenation of all features produced by the set of filters. This feature is then fed into a dense layer which produces the final defects score [7]. This parallel architecture results in an efficient detection engine that can process up to 3,000 images per second on a Tesla T4 GPU, while also requiring fewer samples of images to train (a few hundred samples are sufficient). Additionally, this architecture is inspired by the template matching method commonly used in traditional computer vision for object detection when there is limited data. In this architecture, the defective templates represented by the filters are learned from the training images, rather than being manually chosen as in traditional template matching methods. The size of the filters should be approximately the same as the size of the defective spots in the components. Since there are a variety of defects with different sizes, different filter types with corresponding sizes are used. For large defect spots, the filter sizes can be large, resulting in slow processing, therefore, the filters are downscaled. The method was trained on a dataset of over 1 billion inspected components.

IV. EXPERIMENTAL METHODOLOGY

In order to demonstrate the effectiveness of the proposed method, we present two case studies of failure analysis for two different electronic components: VSON-12 Gate Drivers NexFET (with moisture sensitivity level (MSL) 2, hence it is sensitive to moisture and must be kept according to standards in vacuum during storage and handling) and QFN-12 Power switch (MSL 1). The method was implemented in a full-scale, high-volume SMT production line, using the presented authentication system, which inspects all components assembled on all PCBs in real-time using the ASM-SX vision system's mounting machine.

Although the presented method provided real-time alerts, during the test period, the system only reported on deviations after assembly, and no actions were taken in real-time. A retrospective analysis was performed only after analyzing the post-assembly test results. The post-assembly test conducted, In Circuit Test (ICT) is a basic electrical test performed on the PCB. The test consists of resistance, capacitance, and basic electrical signals to find shorts, disconnections, or other faults. This test provides the first level of quality assurance and gives preliminary insight into whether or not there is a problem. In this case, a high failure rate was reported on two different part numbers, in two separate production lines. The involved reels

were isolated and a retrospective analysis was performed.

The reels suspected of containing defective components were inspected using the reel-to-reel authentication system to ensure authenticity before being used in the production line. The pre-production tests reported that the reel was authentic. The reels were then used in the production process. Images of the electronic components were obtained by harvesting them from the pick-and-place machines [16]. The PNP machine picks up the components and takes their picture using a monochrome camera with a resolution of 17 μ m. All component images are then extracted and processed by the algorithm for defects and corrosion detection. This test found a large ratio of components originating from these reels to be contaminated with corrosion. In production, the alerts are used to detect faulty reels and components, and they are blocked. In the next section, we present the post-process analysis of the failures and compare the predictions and alerts of the presented algorithm.

II. RESULTS

A. Case Study 1: Analysis of VSON-12 Package Failure

In this section, we present a failure case of VSON-12 Gate Drivers NexFET electronic components, which are sensitive to moisture with a Moisture Sensitivity Level (MSL) of 2. The failure is attributed to multiple factors, including exposure to humidity during storage and handling, resulting in the growth of corrosion on the exposed metallic parts of the component surface. Additionally, the presence of corrosion on the soldering leads acts as a failure mode in itself, as it propagates over time and affects the package case. Furthermore, the corrosion also affects the soldering leads' wettability, resulting in a partial bond. Fig. 4(A) shows an image of the component taken by the SMT mounting camera during placement, which illustrates the visible evidence of corrosion, and Fig. 4(B) presents an image of a failed component after removal

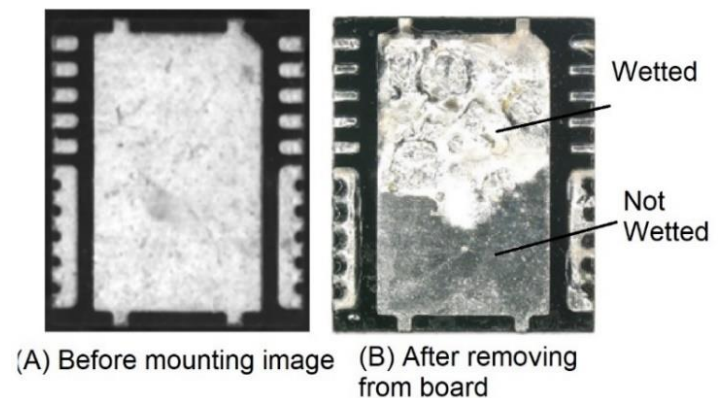


Fig. 4. VSON-12 (A) Image of a component taken by the SMT mounting camera during placement, evidence of corrosion visible, and (B) image of a failed component after removal from the board. In (B) the solder paste residue is visible on the top side, whereas on the bottom side, no evidence of wetting.

> REPLACE THIS LINE WITH YOUR MANUSCRIPT ID NUMBER (DOUBLE-CLICK HERE TO EDIT) <

from the board. The top side of the image in Fig. 4(B) shows residues of the wetted area, while the bottom side of the component appears to not contain paste, only a rough surface finish consistent with corrosion.

To further understand the condition of the inner parts of the component, a Scanning Acoustic Tomography (SAT) analysis was performed. SAT is a non-destructive method for evaluating the structural integrity of materials by measuring the speed and energy of an ultrasonic wave as it travels through a material of a certain thickness. The analysis included a C-scan inspection with a horizontally x-sectioned 2D image after focus and a detailed T-scan (as seen in Fig. 5). The results of the SAT analysis revealed delamination, which is presented in red in the image.

The results of the SAT analysis shown in Fig. 5 clearly indicate that there is a degradation in the internal structure of the component, specifically in the chip's internal metallization. This degradation is likely caused by the corrosion present on the leads as seen in Fig. 4. The poor wettability of the metallic pad, as evidenced by the lack of paste on the bottom side of the component in Fig. 4, also contributed to the failure. This lack of proper wettability resulted in poor heat removal capability from the component to the board via the thermal pad. In summary, the root cause of the failure is the corrosion which affected both the wettability and propagated into the package case, causing internal delamination.

The correlation between the light reflectance from the soldering leads during their placement photography and the extent of the corrosion, as well as the rough surface texture caused by corrosion, were detected by the AI detection algorithm, as seen in the image captured by the ASM vision system during the mounting process (Fig. 4(A) and Fig. 1). This correlation was later verified through cross-referencing with the failed units identified in post-assembly tests, where the algorithm had also predicted contamination by corrosion.

B. Case Study 2: Analysis of QFN-12 Package Failure

The QFN-12 component, despite being MSL-1 and not being sensitive to humidity, was found to have severe corrosion and mold contamination during assembly. The

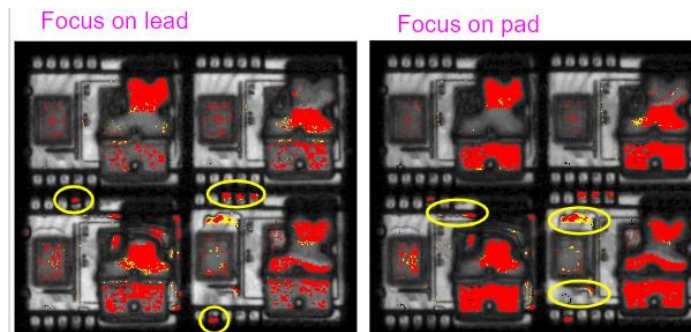


Fig. 5. VSON-12 Scanning Acoustic Tomography image. The red color indicates delamination. The internal delamination appears on the inner part of the soldering leads.

component was 6 years old at the time and the contamination affected the performance of the board. The presented algorithm was able to detect the contamination during the SMT process and flag the component as contaminated. These flagged components were found to have failed in post-assembly tests, with failure modes including shorts, poor solderability, and opens. Approximately 6-11% of the components from this batch were found to have suffered from electrical failures as a result of the corrosion.

X-ray example analysis of the component did not reveal mounting issues except for a short. The short is also visible on the bottom-side image of the component taken before mounting. Shorts are easily detected automatically by the AI algorithm as there is a strong contrast between the light soldering leads and the dark component body. The X-ray shows a metallic short between the pads after the mounting on the PCB. It is impossible to say if the short was already in place before mounting or only created during the mounting. By examining the bottom view image of the component before it was mounted on the PCB it becomes apparent that the short was there even before the assembly (Fig. 7-left).

In addition to the X-ray, more analysis was made as the X-ray could not explain the massive failure rate. The failed boards were analyzed by SED-SEM microscopy. The analysis revealed contamination on the soldering leads as is visible in Fig. 8 where QFN-12 SED SEM analysis example of a soldering pad with a black spot taken by the SMT pick-and-place machine during mounting (left image), compared to a microscopy image taken by the SEM-SED (right image). The black marks are visible on both the pre-assembly Cybord.ai detection (Fig. 8-left) and the SEM-SED post-failure analysis (Fig. 8-right).

The SED analysis reveals that the contamination contains Oxygen, Silicon, and Carbon whereas clean lead doesn't contain any of these materials. Mold contains Silicon (Si), Carbon(C), and Oxygen(O), and oxidation (corrosion) contains Oxygen. From the microscopy images, it is apparent that the black marks are from mold and corrosion. Both are created by exposure to humidity under environmental stress, and both degrade the bond reliability and solderability (see Fig. 9).



Fig. 6. QFN-12 solder bond with the PCB cross-section. A crack is visible between the lead and the paste.

> REPLACE THIS LINE WITH YOUR MANUSCRIPT ID NUMBER (DOUBLE-CLICK HERE TO EDIT) <

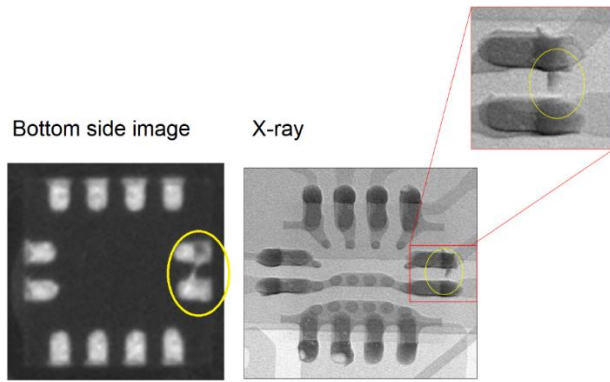


Fig. 7. QFN-12 Short is visible on the bottom view image taken by the SMT pick-and-place machine during mounting (left image), later to be also detected by the X-ray post-failure analysis. (Right image).

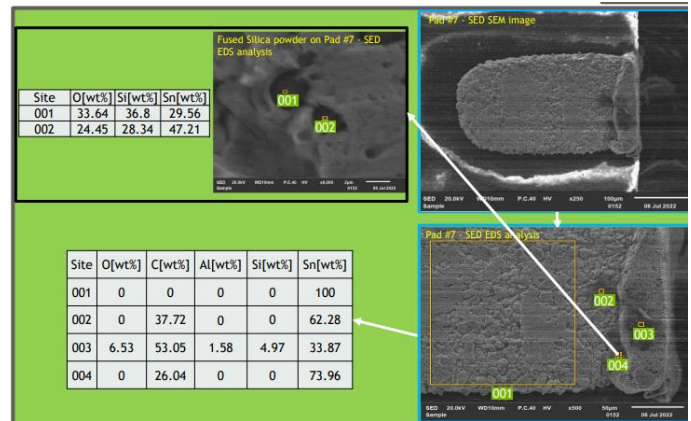


Fig. 9. QFN-12 SED SEM analysis example of a soldering pad with the black spot analyzed. The black spots contain Silicon (Si), Carbon (C), and Oxygen (O), which indicate the presence of mold and oxidation. Both are the result of exposure to humidity and environmental stress.

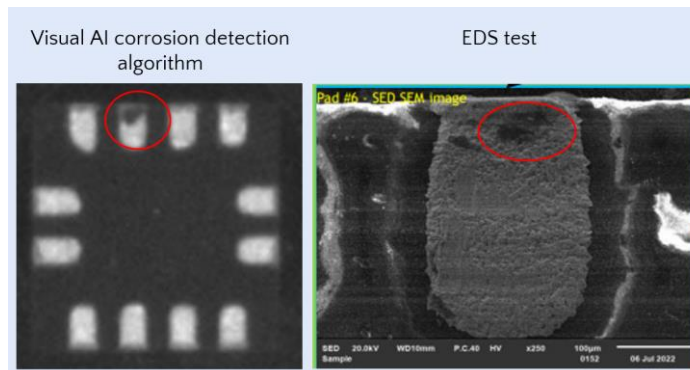


Fig. 8. QFN-12 SED SEM analysis example of a soldering pad with a black spot taken by the SMT pick-and-place machine during mounting (left image), compared to a microscopy image taken by the SEM-SED (right image).

Further microscope inspection of components that did not go through production is presented in Fig. 10. It shows the QFN-12 SED microscope images. (A, C): Rough surface finish caused by corrosion and evidence of old and corrosion at the edges of the leads. (B): zoom on mold at the edges of the soldering leads. As depicted, the surface finish, the corrosion marks, and the mold are also visible during the assembly by the SMT pick-and-place vision system.

II. DISCUSSION

The results section demonstrates that the surface finish quality of the soldering leads can be evaluated through imaging. Soldering leads and balls, made of chemically unstable materials, are prone to aging faster than other components. The surface of the leads develops an oxidation layer and intermetallic reactions occur over time, both of which negatively impact solderability. This degradation is visually apparent, as the oxidation layer and altered metallic morphology have distinct characteristics and reflectivity compared to that of a new lead.

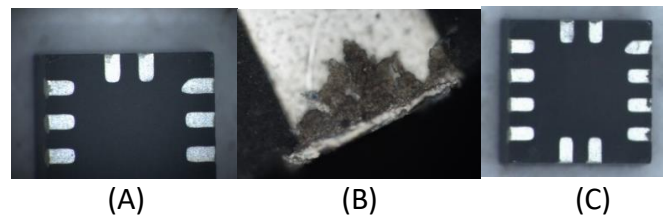


Fig. 10. QFN-12 SED microscope images. (A, C): Rough surface finish caused by corrosion and evidence of old and corrosion at the edges of the leads. (B): zoom on mold at the edges of the soldering leads.

The changes in the surface texture and color of the soldering leads can affect the way light is reflected from the surface, as observed in [27]. This change in reflectance is similar to the difference between a clear and a tarnished mirror. The alteration in texture is a result of the morphological changes that occur during aging, as previously simulated and reported in [3]. These changes involve the gradual shift of metallic alloys and the formation of a brittle corrosion layer, which ultimately leads to breaks in the surface finish.

Our method utilizes machine learning to classify the level of corrosion on the leads by analyzing the way light is reflected off of the component's soldering leads, as compared to leads with corrosion. Additionally, the apparent age of the component can be estimated by analyzing the gradual degradation of the lead's reflectance.

Artificial intelligence techniques can be used to detect the degradation of soldering leads in electronic components, which can lead to corrosion. By training a model using multiple images of leads, the neural network can detect the corrosion level and estimate the solderability of the leads. It is important to note that the age of the component does not necessarily reflect the quality of the lead, as storage and handling conditions can accelerate aging and degrade the lead's condition. The AI-based analysis can detect variations in the condition of leads, including both good and poor conditions.

> REPLACE THIS LINE WITH YOUR MANUSCRIPT ID NUMBER (DOUBLE-CLICK HERE TO EDIT) <

The neural network model is designed to minimize the distance between the input dataset and a linear regression line. Using this model, we can infer the age of components from the validation set. By comparing the predictions of the algorithm with failure analysis results from a full-scale production line, we can simulate real-life conditions. The results show that the method can effectively detect and prevent failures caused by corrosion contamination of soldering leads. It is important to note that while this method can detect issues at the production site, it is also essential to set a threshold that will prevent failure in the field after exposure to environmental stressors. This threshold can be calibrated to detect both solderability issues that fail in the production site and corrosion contamination that will fail later in the field.

II. CONCLUSION

In this paper, we have presented a non-destructive method for assessing the condition of the soldering leads of electronic components through deep visual inspection. This method allows real-time assessment of all assembled components during the SMT mounting process. By analyzing the surface reflectance of the leads, the method is able to detect and classify the level of corrosion contamination and its correlation to reliability failures caused by corrosion and intermetallic reactions on the surface of the leads. Our multi-tier classification network, trained on a dataset of over 1 billion inspected components, is able to classify leads into good and poor corrosion levels based on their apparent age and contamination. The proposed method has the potential to be used in production lines to prevent failures caused by deteriorated soldering leads due to corrosion contamination.

The proposed method for non-destructive assessment of electronic components' soldering leads using deep visual inspection was successfully deployed and evaluated in a full-scale, state-of-the-art production facility. The method's ability to predict failures and failure modes on over 30,000 components with accuracy exceeding 99.5% was demonstrated through cross-checking with failure analysis results on over 2.5 billion components. The failure analysis revealed evidence of corrosion that had penetrated the inner package of the component in one case, and corrosion and mold deteriorating the wettability and thus, solderability in another case.

The proposed method's predictions were in line with the analysis report, and its implementation can help avoid the placement of components with solderability and corrosion issues, ensuring that only qualified components are used in production, thus avoiding failures, recalls, and reworks in the field.

ACKNOWLEDGMENTS

The authors would like to acknowledge the assistance of Mr. Michael Dolkin, and Alon Shahar from Flex for their support.

REFERENCES

- [1] P. Aryan, S. Sampath, and H. Sohn, "An overview of non-destructive testing methods for integrated circuit packaging inspection," *Sensors (Switzerland)*, vol. 18, no. 7, 2018, doi: 10.3390/s18071981.
- [2] E. Weiss, "Counterfeit mitigation by in-line deep visual inspection," *SMTA*, 2021. <http://iconnect007.uberflip.com/i/1440051-smt007-jan2022/87?>
- [3] J. Wang, G. Chen, F. Sun, Z. Zhou, Z. Q. Liu, and C. Liu, "Combined effects of surface oxidation and interfacial intermetallic compound growth on solderability degradation of electrodeposited tin thin films on copper substrate due to isothermal ageing," *Corros. Sci.*, vol. 139, pp. 383–394, Jul. 2018, doi: 10.1016/j.corsci.2018.05.020.
- [4] "EIA/IPC/JEDEC J-STD-002D." [Online]. Available: www.ipc.org.
- [5] J. R. Villalobos-cano and W. C. Johnson, "Advanced manufacturing Technolugu A Solderability Inspection System," no. February 1991, pp. 144–149, 1992.
- [6] S. E. Harpe *et al.*, "METHOD 208, SOLDERABILITY," *MIL-STD*, no. 2, 2015, doi: 10.5897/ERR2015.
- [7] E. Weiss, "AI Detection of Body Defects and Corrosion on Leads in Electronic Components, and a study of their Occurrence," *IEEE PAINE*, 2022.
- [8] V. Verdingovas, M. S. Jellesen, and R. Ambat, "Relative effect of solder flux chemistry on the humidity related failures in electronics," *Solder. Surf. Mt. Technol.*, vol. 27, no. 4, pp. 146–156, Sep. 2015, doi: 10.1108/SSMT-11-2014-0022.
- [9] E. H. Wong, S. W. Koh, K. H. Lee, and R. Rajoo, "Comprehensive treatment of moisture induced failure - Recent advances," *IEEE Trans. Electron. Packag. Manuf.*, vol. 25, no. 3, pp. 223–230, Jul. 2002, doi: 10.1109/TEPM.2002.804613.
- [10] H. Conseil, M. S. Jellesen, V. Verdingovas, and R. Ambat, "Decomposition studies of no-clean solder flux systems in connection with corrosion reliability of electronics," in *European Corrosion Congress (Eurocorr), Estoril*, 2013, pp. 1–5.
- [11] K. Piotrowska, V. Verdingovas, M. S. Jellesen, and R. Ambat, "General rights Contamination, potential bias and humidity effects on electrical performance and corrosion reliability of electronic devices Contamination, potential bias and humidity effects on electrical performance and corrosion reliability of electronic devices."
- [12] E. Weiss and Z. Efrat, "SYSTEM AND METHOD FOR NONDESTRUCTIVE ASSESSING OF SOLDERABILITY OF ELECTRONIC COMPONENTS," P-603537-PC, 2021.
- [13] E. Weiss, "Electronic component solderability assessment algorithm by deep external visual inspection," Dec. 2020, doi: 10.1109/PAINE49178.2020.9337565.
- [14] E. Weiss, "Electronic Component Analytics and Traceability." www.cybord.ai.
- [15] E. Weiss and Z. Efrat, "TRACING COMPONENTS OF ELECTRONIC ASSEMBLY," P-603538-PC, 2021.
- [16] E. Weiss, "SYSTEM AND METHOD FOR DETECTION OF COUNTERFEIT AND CYBER ELECTRONIC COMPONENTS," 2019.
- [17] R. Ambat, H. Conseil-Gudla, and V. Verdingovas, "Corrosion in electronics," in *Encyclopedia of Interfacial Chemistry: Surface Science and Electrochemistry*, Elsevier, 2018, pp. 134–144.
- [18] R. Hienonen and R. Lahtinen, *Corrosion and climatic effects in electronics*. VTT Technical Research Centre of Finland, 2000.
- [19] M. S. Jellesen, D. Minzari, U. Rathinavelu, P. Møller, and R. Ambat, "Corrosion failure due to flux residues in an electronic add-on device," *Eng. Fail. Anal.*, vol. 17, no. 6, pp. 1263–1272, Sep. 2010, doi: 10.1016/j.engfailanal.2010.02.010.
- [20] K. Piotrowska, R. Ud Din, F. B. Grumsen, M. S. Jellesen, and R. Ambat, "Parametric Study of Solder Flux Hygroscopicity: Impact of Weak Organic Acids on Water Layer Formation and Corrosion of Electronics," *J. Electron. Mater.*, vol. 47, no. 7, pp. 4190–4207, Jul. 2018, doi: 10.1007/s11664-018-6311-9.
- [21] V. Verdingovas, M. S. Jellesen, and R. Ambat, "Solder Flux Residues and Humidity-Related Failures in Electronics: Relative Effects of Weak Organic Acids Used in No-Clean Flux Systems," *J. Electron. Mater.*, vol. 44, no. 4, pp. 1116–1127, Apr. 2015, doi: 10.1007/s11664-014-3609-0.
- [22] K. Piotrowska, V. Verdingovas, and R. Ambat, "Humidity-related failures in electronics: effect of binary mixtures of weak organic acid activators," *J. Mater. Sci. Mater. Electron.*, vol. 29, no. 20, pp. 17834–17852, Oct. 2018, doi: 10.1007/s10854-018-9896-0.

[1] P. Aryan, S. Sampath, and H. Sohn, "An overview of non-destructive testing methods for integrated circuit packaging

> REPLACE THIS LINE WITH YOUR MANUSCRIPT ID NUMBER (DOUBLE-CLICK HERE TO EDIT) <

- [23] X. He, M. H. Azarian, and M. G. Pecht, "Evaluation of electrochemical migration on printed circuit boards with lead-free and tin-lead solder," *J. Electron. Mater.*, vol. 40, no. 9, pp. 1921–1936, Sep. 2011, doi: 10.1007/s11664-011-1672-3.
- [24] J. D. Sinclair, "Corrosion of Electronics The Role of Ionic Substances."
- [25] A. Alloqmani, Y. B. Abushark, and A. I. Khan, "Deep Learning based Anomaly Detection in Images: Insights, Challenges and Recommendations," *Int. J. Adv. Comput. Sci. Appl.*, vol. 12, no. 4, pp. 205–215, 2021, doi: 10.14569/IJACSA.2021.0120428.
- [26] S. Cheng, C.-M. Huang, and M. Pecht, "A review of lead-free solders for electronics applications," *Microelectron. Reliab.*, vol. 75, pp. 77–95, 2017.
- [27] J.-M. Song, Y.-C. Chang-Chien, B.-C. Huang, W.-T. Chen, C.-R. Shie, and C.-Y. Hsu, "Spectroscopic investigation of oxidized solder surfaces," *Corros. Sci. - CORROS SCI*, vol. 53, pp. 2283–2288, Jun. 2011, doi: 10.1016/j.corsci.2011.03.011.



Eyal Weiss is a multidisciplinary technology expert, with a background in machine learning, plasma physics, optical assemblies, laser technology, and electromagnetics. He is a recipient of multiple awards, including the prestigious "Israel security prize" twice. He has 17 years of experience leading research at Soreq Research Center (SRC) and has designed and built several manufacturing production lines utilizing advanced technology and AI. He holds a B.Sc in Mechanical Engineering, M.Sc. in Plasma Physics from the Technion-Israel Institute of Technology, and a Ph.D. in Electronic and Computer Engineering from the Ben-Gurion University of the Negev. He is the founder and CTO of Cybord, which develops electronic component qualification and authentication technologies. Dr. Weiss is a member of the Israel Innovation Authority, Euramet, SAE, and IPC committees and has published over 25 peer-review articles, 4 patents, and a book.